

PD6700-0L1 Field-Mount Loop-Powered Process Meter with Bargraph

Instruction Manual



vantageview

SAFE TOUCH™

- NEMA 4X, IP66 Loop-Powered Field-Mount Process Meter
- 4-20 mA Input with $\pm 0.03\%$ Accuracy
- 3.0 Volt Drop (6.0 Volt Drop with Backlight)
- Easy Field Scaling in Engineering Units without Applying an Input
- 0.6" (15.2 mm) 5 Digits Upper Display
- 0.4" (10.2 mm) 7 Alphanumeric Characters Lower Display
- Display Mountable at 0°, 90°, 180°, & 270°
- SafeTouch™ Through-Window Button Programming
- Display Input in Two Different Scales Simultaneously - Great for Level Applications
- 20-Segment Level Indicator Bargraph
- Open Collector Output Assignable to High or Low Alarm
- HART® Protocol Transparent
- Loop or External DC-Powered Backlight Standard
- Operating Temperature Range: -40 to 75°C (-40 to 167°F)
- Conformal Coated PCBs for Dust and Humidity Protection
- Password Protection
- 32-Point Linearization
- Wide Viewing Angle
- Flanges for Wall or Pipe Mounting
- Plastic NEMA 4X, IP66 Enclosure
- Three 3/4" NPT Threaded Conduit Openings (Two Plugs Installed)
- Stainless Steel Tag Available
- 3-Year Warranty

PRECISION DIGITAL CORPORATION

233 South Street • Hopkinton MA 01748 USA
Tel (800) 343-1001 • Fax (508) 655-8990

www.predig.com

PRECISION
DIGITAL

Disclaimer

The information contained in this document is subject to change without notice. Precision Digital Corporation makes no representations or warranties with respect to the contents hereof; and specifically disclaims any implied warranties of merchantability or fitness for a particular purpose.

CAUTION

- Read complete instructions prior to installation and operation of the meter.

WARNINGS

- Risk of electric shock or personal injury.
- This product is not recommended for life support applications or applications where malfunctioning could result in personal injury or property loss. Anyone using this product for such applications does so at his/her own risk. Precision Digital Corporation shall not be held liable for damages resulting from such improper use.
- Failure to follow installation guidelines could result in death or serious injury. Make sure only qualified personnel perform the installation.

WARNING

Cancer and Reproductive Harm - www.P65Warnings.ca.gov

Limited Warranty

Precision Digital Corporation warrants this product against defects in material or workmanship for the specified period under "Specifications" from the date of shipment from the factory. Precision Digital's liability under this limited warranty shall not exceed the purchase value, repair, or replacement of the defective unit. See Warranty Information and Terms & Conditions on www.predig.com for complete details.

© 2020 Precision Digital Corporation. All rights reserved.

Introduction

The PD6700-0L1 is a rugged, field-mount, loop-powered meter fully featured for demanding applications in harsh environmental conditions. The bargraph representation of the process input is perfect for level applications and allows for quick assessment of current conditions. The meter derives all its power from the 4-20 mA loop. It is programmed using the four SafeTouch through-window buttons, without removing the cover, and can be scaled with or without a calibration signal. The numeric display will read up to 99999 and the alphanumeric display can be programmed to show any combination of numbers and letters up to seven characters long for use as engineering units, the process identification tag or a display for the calculated volume when using for level applications. The backlight lets you see the display under any lighting condition and can be powered from either the 4-20 mA loop or from a separate DC power supply.

The enclosure is provided with three threaded conduit holes and integrated pipe or wall mounting slotted flanges.

Ordering Information

Model	Description
PD6700-0L1	Field-Mount Loop-Powered Process Meter with Bargraph

Accessories

Model	Description
PDAPLUG75P	3/4" NPT Plastic Conduit Plug
PDA1024-01	24 VDC Power Supply for DIN Rail
PDA6846	Steel 2" U-Bolt Kit. All Material: Zinc Plated Steel; (1) U-Bolt for 2" Pipe with (2 each) Washers, Lock Washers, and Nuts.
PDA6846-SS	Stainless Steel 2" U-Bolt Kit. All Material: Stainless Steel; (1) U-Bolt for 2" Pipe with (2 each) Washers, Lock Washers, and Nuts.
PDA-SSTAG	Custom Stainless Steel Tag (see website for convenient ordering form)

Table of Contents

Introduction	2
Ordering Information	2
Specifications	5
General	5
Input	5
Open Collector Output	5
Safety Information	6
Installation	6
Unpacking	6
Pre-Installed Conduit Plug	6
Mounting	6
Dimensions	6
Connections	7
Wiring Diagrams	8
External Acknowledge Connection.....	8
Open Collector Output Connections.....	8
Setup and Programming	9
Overview	9
SafeTouch Buttons	9
SafeTouch Button Operation.....	9
SafeTouch Button Tips and Troubleshooting.....	9
Buttons and Display	10
Main Menu Display Functions & Messages.....	11
Main Menu	11
Setting Up the Meter (SETUP)	12
Setting Numeric Values.....	12
Setting the Level Decimal Point (DECIMAL).....	12
Scaling the Meter (SCALE).....	13
Minimum Input Span.....	13
Scale Error Message (SPN ERR).....	13
Scaling the Tank Level Indicator (PERCENT).....	13
Configuring the Display (DISPLAY).....	13
Setting the Tag (TAG).....	14
Setting Up the Password (PASSWORD)	14
Locking the Meter.....	14
Making Changes to a Password Protected Meter.....	14
Disabling Password Protection.....	14
Advanced Features Menu (ADVANCE)	15
Advanced Features Menu & Display Messages.....	16
Alarm Output (OUTPUT).....	17
Input Signal Filter (FILTER).....	17
Volume Display Scaling (VOLSCALE).....	17
Level Input Live Signal Calibration (LVL CAL).....	18
Internal Calibration (ICAL).....	18
Calibration Error Message (SPN ERR).....	18
Level Input Multipoint Linearization (MULTIPT).....	18
Information (INFO).....	18
Operation	19
Front Panel Buttons Operation	19
Display Maximum, Minimum, and Input Current	19
Reset Meter to Factory Defaults	19
Factory Defaults & User Settings	20
Troubleshooting	20
Troubleshooting Tips	20
Quick User Interface Reference	21

Table of Figures

Figure 1. Enclosure Dimensions – Front View.....	6
Figure 2. Enclosure Dimensions – Side Cross Section View	6
Figure 3. Connector Board.....	7
Figure 4. Connections without Backlight	8
Figure 5. Connections with Loop-Powered Backlight.....	8
Figure 6. Connections with Externally-Powered Backlight.....	8
Figure 7. External Alarm Reset/Acknowledge Connections.....	8
Figure 8. Connection to Device with Internal Pull-Up	8
Figure 9. Output Connections	8

Specifications

Except where noted all specifications apply to operation at +25°C.

General

Display	Five digits (-9999 to 99999)	0.60" (15.2 mm) high, 7-segment, automatic lead zero blanking.							
	Seven characters	0.4" (10.2 mm) high, 14-segment.							
	Symbols	Bargraph which displays process input from 0-100% of scaled value.							
Display Orientation	Display may be mounted at 90° increments up to 270° from default orientation.								
Display Assignment	Lower display may be assigned to custom unit or tag, volume, volume and tag, percent height, percent height and tag, or off.								
Display Update Rate	Ambient > -25°C: 2 Updates/Second Ambient < -25°C: 1 Update/5 Seconds								
Backlight	White; Loop-powered or externally powered. Backlight can be enabled or disabled via alternative wiring of terminal block. Loop-powered backlight brightness will increase as the input signal current increases. Externally powered backlight has consistent brightness.								
Externally Powered Backlight	Voltage Range:	Maximum Power							
	9-36 VDC	<table border="1"> <tr> <td>9 VDC</td> <td>12 VDC</td> <td>24 VDC</td> <td>36 VDC</td> </tr> <tr> <td>0.2 W</td> <td>0.25 W</td> <td>0.5 W</td> <td>0.75 W</td> </tr> </table>	9 VDC	12 VDC	24 VDC	36 VDC	0.2 W	0.25 W	0.5 W
9 VDC	12 VDC	24 VDC	36 VDC						
0.2 W	0.25 W	0.5 W	0.75 W						
Display Overrange	Display flashes 99999								
Display Underrange	Display flashes -9999								
Programming Method	Four SafeTouch through-window buttons when cover is installed. Four internal pushbuttons when cover is removed.								
Noise Filter	Programmable LO, n, Ed, H I, or OFF								
Recalibration	Recalibration is recommended at least every 12 months.								
Max/Min Display	Max/Min readings reached by the process are stored until reset by the user or until power to the meter is turned off.								
Advanced Function	Linear, square root, or programmable exponent								
Password	Programmable password restricts modification of programmed settings.								
Non-Volatile Memory	All programmed settings are stored in non-volatile memory for a minimum of ten years if power is lost.								
Normal Mode Rejection	64 dB at 50/60 Hz								
Environmental	Operating temperature range: -40 to 75°C Storage temperature range: -40 to 75°C Relative humidity: 0 to 90% non-condensing								
Connections	Screw terminals accept 12 to 22 AWG wire								
Enclosure	NEMA 4X, IP65 plastic field enclosure Color: grey Three ¾" NPT threaded conduit openings. Two ¾" NPT plastic conduit/stopping plugs with 1.29" wrenching flats and screwdriver slot.								

Mounting	May be mounted directly to conduit. Two slotted flanges for wall mounting or NPS 1½" to 2½" or DN 40 to 65 mm pipe mounting. See <i>Dimensions</i> on page 6.
Overall Dimensions	5.67" x 5.25" x 4.18" (W x H x D) (144 mm x 133 mm x 106 mm)
Weight	1.65 lbs (26.4 oz, 0.75 kg)
Warranty	3 years parts and labor. See Warranty Information and Terms & Conditions on www.predig.com for complete details.

Input

Input	4-20 mA	
Accuracy	±0.03% of calibrated span ±1 count, square root & programmable exponent accuracy range: 10-100% of calibrated span.	
Maximum Voltage Drop & Equivalent Resistance	Without Backlight or with Externally Powered Backlight	With Loop-Powered Backlight
	3.0 VDC @ 20 mA 150 Ω @ 20 mA	6.0 VDC @ 20 mA 300 Ω @ 20 mA
Temperature Drift	50 PPM/°C from -40 to 75°C ambient	
Multi-Point Linearization	2 to 32 points	
Decimal Point	User selectable decimal point	
Minimum Span	Input 1 & Input 2: 0.10 mA	
Calibration Range	An <i>Error</i> message will appear if input 1 and input 2 signals are too close together.	
	Input Range	Minimum Span Input 1 & Input 2
	4-20 mA	0.10 mA
Input Overload	Over current protection to 2 A max.	
HART Transparency	The meter does not interfere with existing HART communications; it displays the 4-20 mA primary variable and it allows the HART communications to pass through without interruption. The meter is not affected if a HART communicator is connected to the loop. The meter does not display secondary HART variables.	

Open Collector Output

Rating	Isolated open collector, sinking NPN 30 VDC @ 150 mA max.
Alarm Output	Assign to level or volume for high or low alarm trip point.
Deadband	0-100% FS, user selectable
Acknowledge	Front panel ENTER button and external RESET terminals resets output and screen indication.

Safety Information

⚠ WARNINGS

- Read complete instructions prior to installation and operation of the meter.
- Installation and service should be performed only by trained service personnel.
- If the meter is installed in a high voltage environment and a fault or installation error occurs, high voltage may be present on any lead.

Installation

Wiring connectors are accessed by opening the enclosure. To access electrical connectors, remove the 2 captive screws, then disconnect the ribbon cable from the display module and set the display module aside.

Unpacking

Remove the meter from box. Inspect the packaging and contents for damage. Report damages, if any, to the carrier.

If any part is missing or the meter malfunctions, please contact your supplier or the factory for assistance.

Pre-Installed Conduit Plug

The PD6700-0L1 is supplied with two pre-installed conduit plugs for installations that do not require the use of all three conduit entries.

Mounting

The PD6700-0L1 has two slotted mounting flanges that may be used for pipe mounting or wall mounting. Alternatively, the unit may be supported by the conduit using the conduit holes provided.

Refer to *Figure 1* and *Figure 2* below.

⚠ WARNING

- Do not attempt to loosen or remove flange bolts while the meter is in service.

Dimensions

All units: inches [mm]

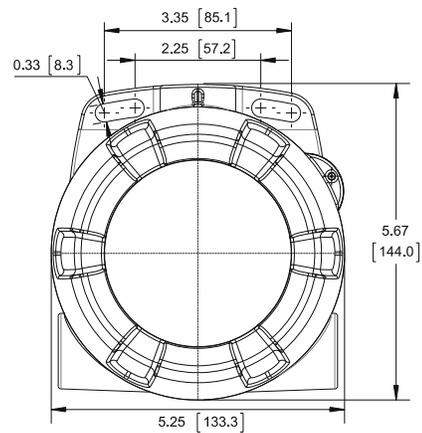


Figure 1. Enclosure Dimensions – Front View

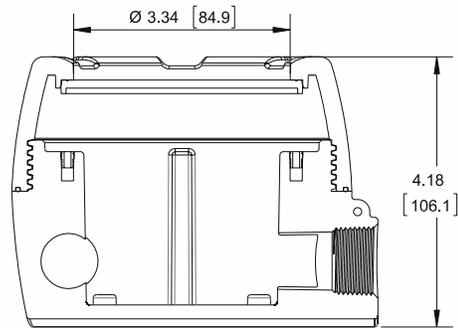


Figure 2. Enclosure Dimensions – Side Cross Section View



Download free 3-D CAD files of these instruments to simplify your drawings!

predig.com/documentation-cad

Connections

To access the connectors, remove the enclosure cover and unscrew the two captive screws that fasten the display module. Disconnect the ribbon cable and remove the display module. Signal connections are made to a four-terminal connector in the base of the enclosure.

SIGNAL +	4-20 mA signal input positive terminal connection
SIGNAL -	4-20 mA signal return/negative terminal connection when not using loop powered backlight.
BACKLIGHT +	+9-36 VDC when powering backlight from external supply.
BACKLIGHT -	4-20 mA signal return/negative terminal when using the installed loop powered backlight or ground/negative when powering backlight from external supply.
OUTPUT+	NPN open collector output positive.
OUTPUT-	NPN open collector output negative.
RESET +	Contact closure alarm acknowledge, pull up to 3 VDC.
RESET-	Contact closure alarm acknowledge ground/negative.

Refer to *Figure 3* for terminal positions.

⚠ WARNINGS

- Observe all safety regulations. Electrical wiring should be performed in accordance with all agency requirements and applicable national, state, and local codes to prevent damage to the meter and ensure personnel safety.
- Static electricity can damage sensitive components.
- Observe safe handling precautions for static-sensitive components.
- Use proper grounding procedures/codes.
- If the meter is installed in a high voltage environment and a fault or installation error occurs, high voltage may be present on any lead or terminal.

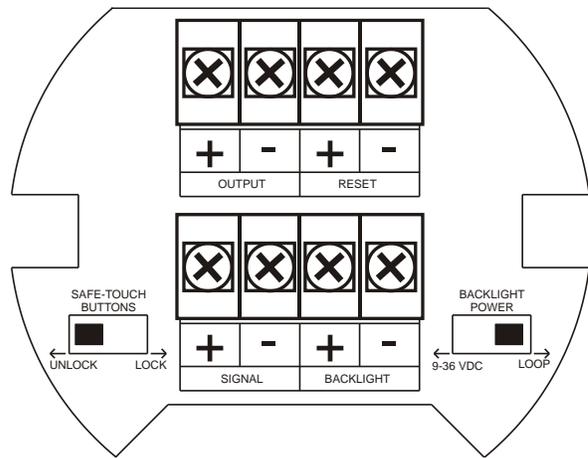


Figure 3. Connector Board

Wiring Diagrams

Signal connections are made to a four-terminal connector mounted in the base of the enclosure per *Figure 3. Connector Board*. The enclosure also provides one internal and one external earth grounding screw.

For installations that don't use the backlight, the maximum voltage drop is 3 V and connections are made per *Figure 4*.

For installations that use the backlight powered from the loop, the maximum voltage drop is 6 V and connections are made per *Figure 5*.

For installations that use the backlight powered from an external source, the maximum voltage drop is 3 V and connections are made per *Figure 6*.

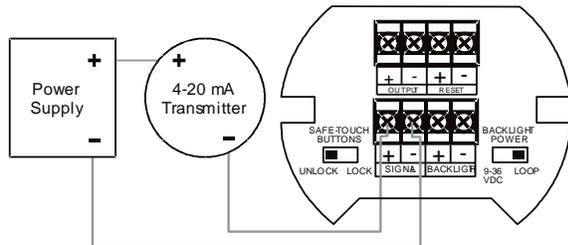


Figure 4. Connections without Backlight

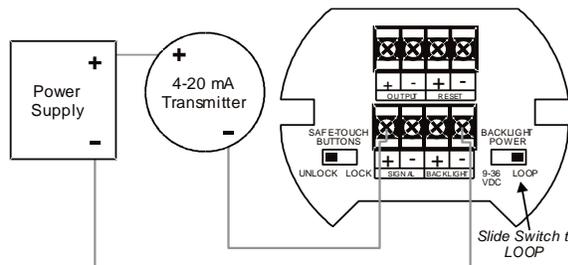


Figure 5. Connections with Loop-Powered Backlight

Loop-powered backlight brightness will increase as the input signal current increases. If constant backlight brightness is desired, the backlight should be powered by an external source.

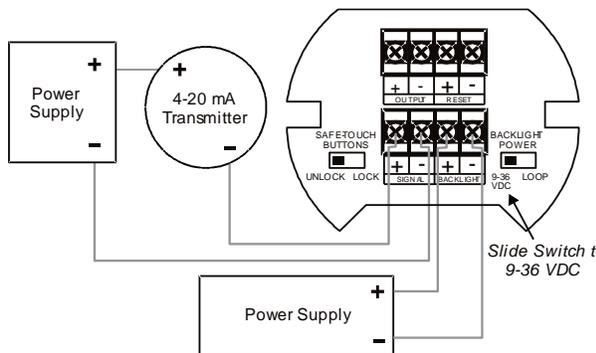


Figure 6. Connections with Externally-Powered Backlight

It is possible to use the same transmitter (signal loop) power supply for the externally powered backlight. The backlight circuit will draw 25 mA in addition to the loop circuit.

External Acknowledge Connection

External acknowledge connections are made to two terminals labeled RESET. Connect to a contact closure source such as a relay or a pushbutton as shown in *Figure 7*.

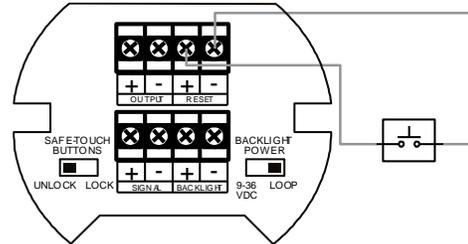


Figure 7. External Alarm Reset/Acknowledge Connections

Open Collector Output Connections

Output connections are made to two terminals labeled OUTPUT. The output can be connected to an input device such as alarm indicator as shown in *Figure 8*, or to drive a relay as shown in *Figure 9*.

WARNING

- To avoid damaging the PD6700-0L1's amplifying components, use care not to wire incorrectly or exceed output ratings. A diode, such as 1N4000 series, will provide protection from relay transients.

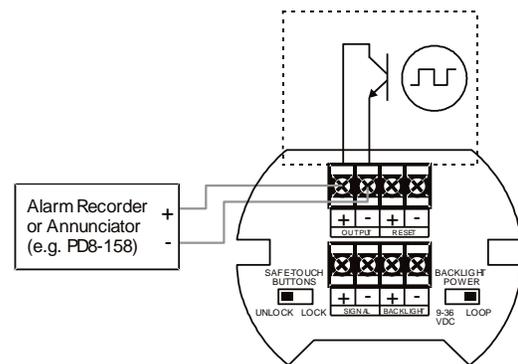


Figure 8. Connection to Device with Internal Pull-Up

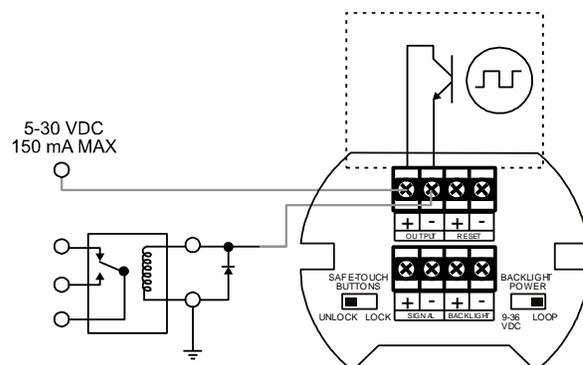


Figure 9. Output Connections

Setup and Programming

There is **no need to recalibrate** the meter when first received from the factory. Simply scale the meter to display the process in engineering units.

The meter is **factory calibrated** and it is scaled to read 0.0 to 100.0%, which correspond to a 4-20 mA input. The calibration equipment is traceable to NIST standards.

Overview

Setup and programming is done through the infrared through-window SafeTouch buttons or using the mechanical buttons when uncovered. There are two slide switches located on the connector board. One is used to select backlight power and the other is to lock or unlock the SafeTouch Buttons.

After all connections have been completed and verified, connect the ribbon cable to the display module, fasten the display module to the base, install enclosure cover, and then apply power.

SafeTouch Buttons

The PD6700-0L1 is equipped with four sensors that operate as through-window buttons so that it can be programmed and operated without removing the cover and exposing the electronics to the environment. These buttons can be disabled for security by selecting the LOCK setting on the SAFE-TOUCH BUTTONS switch located on the connector board in the base of the enclosure.

SafeTouch Button Operation

To actuate a button, press and remove one finger to the window directly over the marked button area. Remove finger to at least 4 inches away from the window in between button activations. SafeTouch and mechanical buttons may be held to cycle through menus or digits in place of repeatedly pushing a button. The sensors are disabled when a mechanical button is pressed and will automatically be re-enabled after 60 seconds of inactivity.

SafeTouch Button Tips and Troubleshooting

The SafeTouch buttons are designed to filter normal levels of ambient interference and to protect against false triggering, however, it is recommended that the SafeTouch buttons be disabled (slide switch to LOCK) if there is an infrared interference source in line-of-sight to the display.

SafeTouch Button Tips:

- To the extent possible, install the display facing away from sunlight, windows, reflective objects and any sources of infrared interference.
- Keep the window clean.
- Tighten the cover securely.
- Use a password to prevent tampering.
- If the cover has not been installed and secured tightly, it may take a moment for the SafeTouch buttons to properly self-calibrate when the cover is tightened.

IMPORTANT

- SafeTouch buttons will not work if two or more buttons are detected as being pressed simultaneously. As a result, be careful to avoid triggering multiple buttons or reaching across one button location to press another.

Buttons and Display



Button Symbol	Description
	Menu
	Right arrow/Reset
	Up arrow/Display
	Enter

Symbol	Status
	20-Segment Tank Level Indicator Bargraph
	Password Enabled

Menu Button

- Press the **Menu** button to enter Programming Mode.
- Press the **Menu** button during Programming Mode to return to the previous menu selections.
- Hold the **Menu** button for 1.5 seconds at any time to exit Programming Mode and return to *Run Mode*.
- Press and hold the **Menu** button for 5 seconds to access the *Advanced Features* of the meter.

Right / Reset Button

- Press the Right arrow button to reset the maximum or minimum value while it is being displayed (see **Up / Display Button** below).
- Press the **Right** arrow button to move to the next digit or decimal position during programming.
- Press **Right** to go backward through most selection menus.

Up / Display Button

- Press Display when in Run Mode to cycle through displaying the maximum value, minimum value, and the loop input value in mA. The display will time out in 12 seconds. Press Display again to resume normal lower display operation (lower display will read *RESUME*).
- Press the **Up** arrow button to scroll forward through the menus, decimal point, or to increment the value of a digit.

Enter Button

- Press the **Enter** button to access a menu or to accept a setting.
- Press **Enter** to acknowledge alarm (if enabled).


Main Menu Display Functions & Messages

The meter displays various functions and messages during setup, programming, and operation. The following table shows the main menu functions and messages in the order they appear in the menu.

Display	Parameter	Action/Setting
SETUP	Setup	Enter Setup menu
DECIMAL	Decimal Point	Enter the decimal point location
SCALE	Scale	Enter the Scale menu for engineering units
INPUT 1	Input 1	Set input 1 value in mA
DISP 1	Display 1	Set display 1 engineering units
INPUT 2	Input 2	Set input 2 value in mA
DISP 2	Display 2	Set display 2 engineering units
SAVE ?	Save?	Save entered scale parameters?
SPN ERR	Span Error	Scale point 1 and 2 span error
PERCENT	Percent	Scale the tank indicator full and empty values
0 PCT	0 Percent	Set the tank empty value
100 PCT	100 Percent	Set the tank full value
DISPLAY	Display	Enter Bottom Display menu
TAG	Tag	Display a custom unit or tag
VOLUME	Volume	Display volume
VOL+TAG	Volume + Tag	Display volume and custom tag
PCT HT	Percent Height	Display percent height
PCT+TAG	Percent Height + Tag	Display percent height and custom tag
OFF	Off	Disable lower display
ADVANCE	Advanced	Advanced Features Menu (See Advanced Features Menu (ADVANCE) on page 15)
PASSWORD	Password	Enter the Password menu
UNLOCK	Unlocked	Program password to lock meter
LOCKED	Locked	Enter password to unlock meter
SETUP	Setup	Enter Setup menu

Main Menu

The main menu consists of the most commonly used functions: *Setup*, *Advanced*, and *Password*. Press **MENU** button to enter *Programming Mode* then press the **Up Arrow** button to scroll through the main menu.

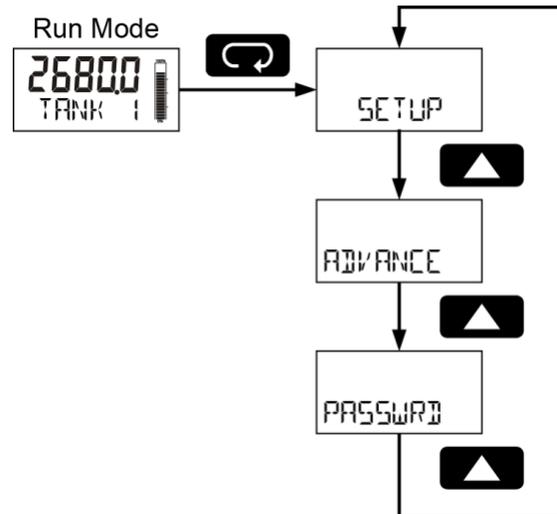

Hold **MENU**, at any time, to exit and return to *Run Mode*. Changes made to settings prior to pressing **ENTER** are not saved.

Press the **MENU** button during *Programming Mode* to return to the previous menu selections.

Changes to the settings are saved to memory only after pressing **ENTER**.

The display moves to the next menu every time a setting is accepted by pressing **ENTER**.

Setting Up the Meter (SETUP)


The *Setup* menu is used to select:

1. Decimal point location
2. Scale in engineering units
3. Tank indicator 0 and 100%
4. Lower display selection
5. Turn on/off bargraph (Tank indicator)

Press the **ENTER** button to access any menu or press **UP** arrow button to scroll through choices.

Hold **MENU**, at any time, to exit and return to Run Mode. Changes made to settings prior to pressing **ENTER** are not saved.

Press the **MENU** button during Programming Mode to return to the previous menu selections.

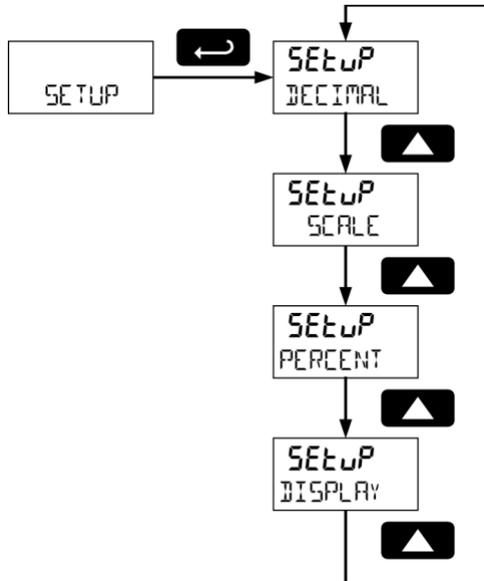

Setting Numeric Values

The numeric values are set using the **RIGHT** and **UP** arrow buttons. Press **RIGHT** arrow to select next digit and **UP** arrow to increment digit.

The digit being changed blinks.

Press the **ENTER** button, at any time, to accept a setting.

Hold **MENU**, at any time, to exit and return to Run Mode. Changes made to settings prior to pressing **ENTER** are not saved.

 
Press the **MENU** button during Programming Mode to return to the previous menu selections.



Setting the Level Decimal Point (DECIMAL)

Decimal point may be set with up to four decimal places or with no decimal point.

Pressing the **Right** arrow moves the decimal point one place to the right and pressing the **Up** arrow moves the decimal point one place to the left.




Scaling the Meter (SCALE)

The 4-20 mA input can be scaled to display the process in engineering units. To scale the meter, enter the value in milliamps (mA) for input 1, and then the corresponding engineering units display value. Do the same for input 2.

After entering the display 2 value, confirm the new scale by pressing **ENTER** at the Save menu.

A signal source is not needed to scale the meter; simply program the inputs and corresponding display values.

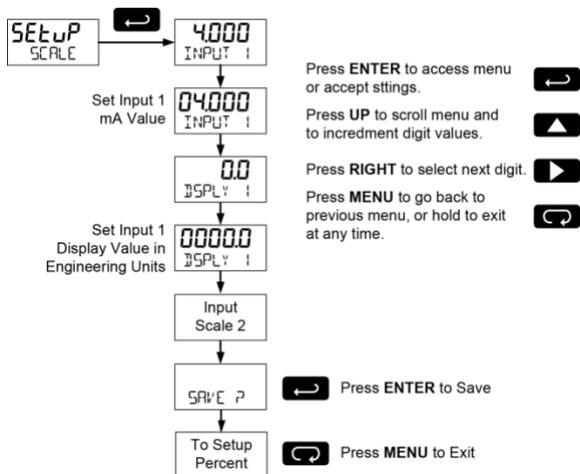

For instructions on using multipoint scaling, see *Level Input Multipoint Linearization (MULTIPOINT)* on page 18.

Minimum Input Span

The minimum input span is the minimum difference between input 1 and input 2 signals required to complete the calibration or scaling of the meter. The minimum span is 0.10 mA.

Scale Error Message (SPN ERR)

If the minimum span is not maintained, the meter will show a span error (SPN ERR) and revert to input 1, allowing the appropriate input signals to be applied.


Note: The Scale and Calibrate functions are exclusive of each other. The meter uses the last function programmed. Only one of these methods can be employed at a time. The Scale and Calibrate functions can use up to 32 points (default is 2). The multi-point linearization should be enabled in the Advanced Features menu under the Level Input Multipoint Linearization (MULTIPOINT) menu selection, prior to scaling and calibration of the meter, see *Advanced Features Menu (ADVANCE)* on page 15.

Scaling the Tank Level Indicator (PERCENT)

The display includes a 20-segment tank level indicator. This menu sets full and empty values, in engineering units, for the tank level indicator.

This value may differ from the 20 mA full-scale and 4 mA empty-scale values programmed in the *Scale* menu. This is ideal for level transmitters that output less than 20 mA at the maximum height of the tank or pit or more than 4 mA at the minimum height.

As an example, when using a level transmitter that outputs 20 mA at 25 meters, the tank height indicator may be set for a maximum of 10 meters. When the meter reaches 10 meters on the display, the tank height indicator will show full, even though the input is not 20 mA.

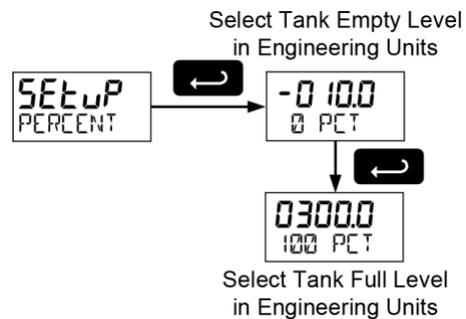


Configuring the Display (DISPLAY)

The lower (BOTTOM) display may be configured to display a custom tag (TAG), volume (VOLUME), volume and tag (VOL+TAG), percent of full height (PCT HT), percent of full height and tag (PCT+TAG), or be blank (OFF).

A custom tag of up to seven alphanumeric characters may be programmed for identification (e.g. TANK 3) or for engineering units (e.g. GALLONS).

Percent full height shows the percent full of the tank height level indicator programmed in the Scaling the Tank Level Indicator (PERCENT) menu.


The tank level indicator (GRAPH) may also be turned on or off from the display menu.

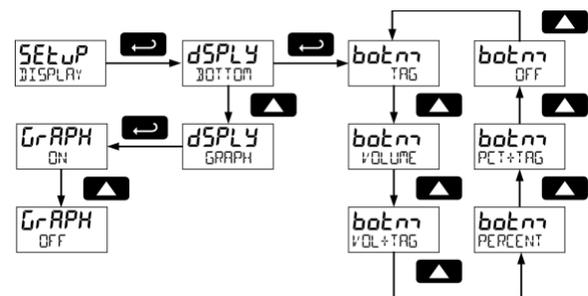


Note: Volume is a separate, second scale of the input process variable. This is configured in *Volume Display Scaling (VOLSCALE)* on page 17.

Setting the Tag (TAG)

Any lower display setting that includes a tag will require the tag to be entered.

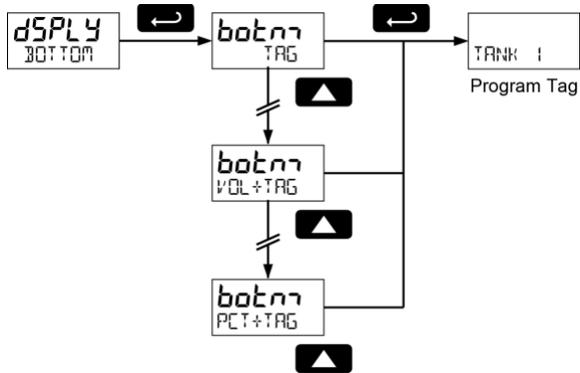

The fully alphanumeric values for the tag are set using the **RIGHT** button to select the digit, the **UP** and **RIGHT** arrow buttons to select the digit reading, and the **ENTER** button to confirm and select the next digit.

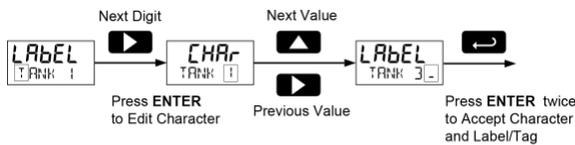

Setting Up the Password (PASSWORD)

The *Password* menu is used to program a five-digit password to prevent unauthorized changes to the programmed parameter settings. A password protected meter will display **LOCKED** when the **MENU** button is pressed.

Locking the Meter

Enter the *Password* menu and program a five-digit password.

For instructions on how to program numeric values see *Setting Numeric Values*, page 12.




Record the password for future reference. If appropriate, it may be recorded in the space provided.

Model:	
Serial Number:	
Password:	__ _ _ _ _


Making Changes to a Password Protected Meter

If the meter is password protected, the meter will display the message **LOCKED** when the Menu button is pressed. Press the Enter button while the message is being displayed and enter the correct password to gain access to the menu. After exiting the programming mode, the meter returns to its password protected condition.

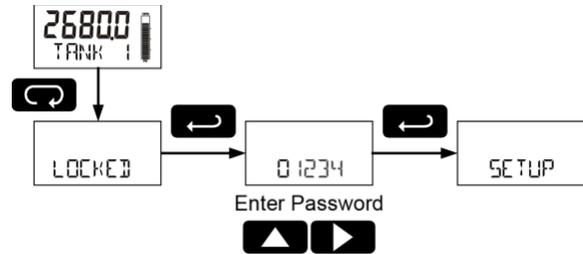

Disabling Password Protection

To disable the password protection, access the *Password* menu and enter the correct password, as shown below.

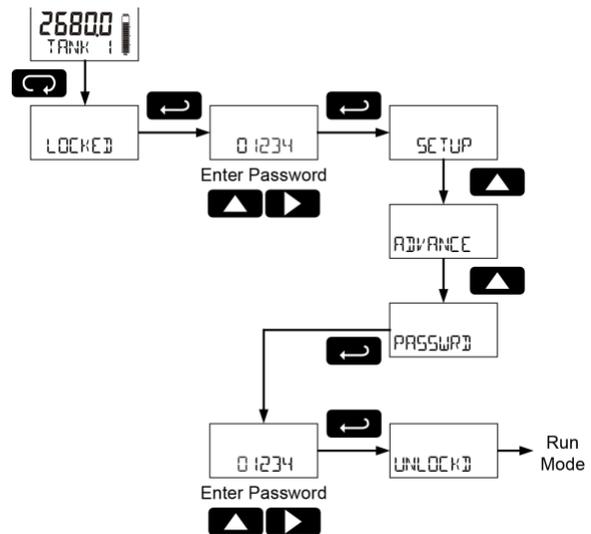

If the correct five-digit password is entered, the meter displays the message **UNLOCKED** (*unlocked*) and the protection is disabled until a new password is programmed.

If the password entered is incorrect, the meter displays the message **LOCKED** and returns to Run Mode. To try again, repeat the above procedure.

Did you forget the password?


The password may be disabled by entering a master password. If you are authorized to make changes, enter the master password 50865 to unlock the meter.

Advanced Features Menu (ADVANCE)

To simplify the setup process, functions not needed for most applications are located in the *Advanced Features Menu*. Access the *Advanced Features Menu* by pressing **ENTER** at the ADVANCE menu in the *Main Menu* defined on page 11.

The *Advanced Features Menu* is used to select:

1. Open collector output configuration (OUTPUT)
2. Input filter (FILTER)
3. Volume display scale (VOLSCAL)
4. Live signal level display calibration (LVL CAL)
5. Internal Calibration (ICAL)
6. Multipoint linearization enable (MULTIPT)
7. Meter system information display (INFO)

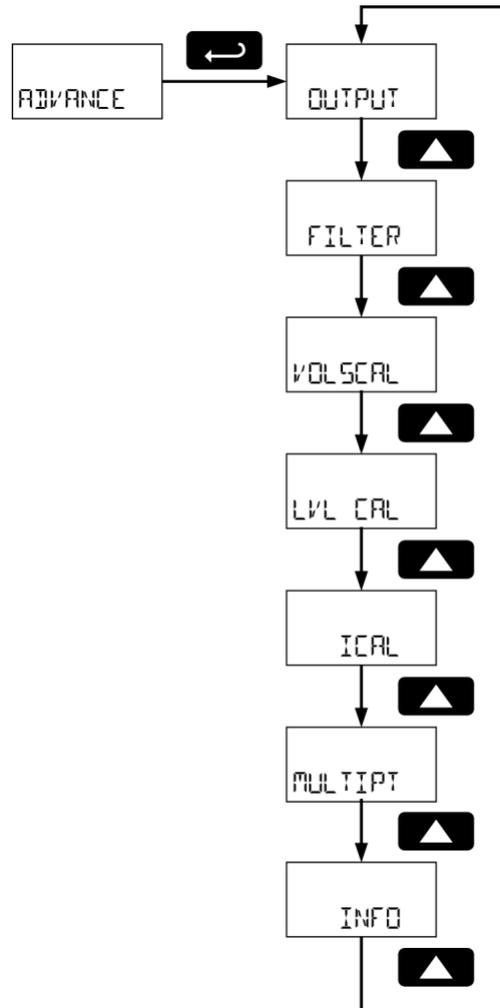

Advanced Features Menu & Display Messages

The following table shows the *Advanced* features menu functions and messages in the order they appear in the menu.

Display	Parameter	Action/Setting
OUTPUT	<i>Output</i>	Enter output menu
OFF	<i>Off</i>	Disable output
ALARM	<i>Alarm Output</i>	Enter alarm output menu
LEVEL	<i>Level Alarm</i>	Assign alarm output to level
SET	<i>Set Point</i>	Set alarm set point
RESET	<i>Reset Point</i>	Set alarm reset point
VOLUME	<i>Volume Alarm</i>	Assign alarm output to volume
FILTER	<i>Filter</i>	Set noise filter
LO	<i>Filter Low</i>	Set noise filter to low setting
Med	<i>Filter Medium</i>	Set noise filter to medium setting
H I	<i>Filter High</i>	Set noise filter to high setting
OFF	<i>Filter Off</i>	Disable noise filter
VOLSCAL	<i>Volume Scale</i>	Scale the volume display
VOL DECIMAL	<i>Volume Decimal</i>	Set the decimal position for volume scaling
NO PTS	<i>Number of Points</i>	Set the number of points for volume scaling
INPUT 1	<i>Input 1</i>	Set volume input 1 on the level display
DISPLY 1	<i>Display 1</i>	Set volume display 1
INPUT 2	<i>Input 2</i>	Set volume input 2 on the level display
DISPLY 2	<i>Display 2</i>	Set volume display 2

Display	Parameter	Action/Setting
SAVE P	<i>Save</i>	Save entered volume scale parameters
LVL CAL	<i>Level Calibration</i>	Calibrate the level display
INPUT 1	<i>Input 1</i>	Calibrate input 1 value
DISPLY 1	<i>Display 1</i>	Set display 1 feet and inches
INPUT 2	<i>Input 2</i>	Calibrate input 2 value
DISPLY 2	<i>Display 2</i>	Set display 2 feet and inches
SAVE P	<i>Save</i>	Save entered calibration parameters
ICAL	<i>Internal Calibration</i>	Enter internal reference calibration
4.000	<i>4.000 mA</i>	Calibrate input at 4 mA
20.000	<i>20.000 mA</i>	Calibrate input at 20 mA
SPN ERR	<i>Span Error</i>	Error with calibration point 1 and 2 span
MULTIPT	<i>Multipoint</i>	Set level display multipoint linearization
DISABLE	<i>Disable</i>	Disable multipoint linearization
ENABLE	<i>Enable</i>	Enable multipoint linearization
INFO	<i>Meter Information</i>	Show software number and version, or reset to factory defaults
SOFT	<i>Software</i>	Software number
VER	<i>Software Version</i>	Software version
DEFAULTS?	<i>Reset to Defaults?</i>	Restore factory default parameter settings

Alarm Output (OUTPUT)

The PD6700-0L1 is equipped with an NPN open collector output that may be set up for high or low alarm trip point based on the level display (LEVEL) or the volume scale (VOLUME). The output may be disabled by selecting OFF.

When the alarm is enabled for level and the alarm set point has been reached, the level display will flash, accompanied by the lower display alternating between normal display and ALARM. A tank height indicator segment will flash at the level the alarm is set to while the level indicator is at or above the alarm point.


When the alarm is enabled for volume and the alarm set point has been reached, the lower display will flash, alternating between its normal display and ALARM.

To set a high alarm, program the set point value to be greater than the reset point.

To set a low alarm, program the set point value to be less than the reset point.

To acknowledge an alarm, press the **ENTER** button once for acknowledge prompt and a second time to confirm. Acknowledging an alarm will turn off the alarm output and stop the display from flashing. The lower display will continue to alternate between its normal display and ALARM until the alarm condition is cleared.

The alarm status will show on the display even if the output is not wired.

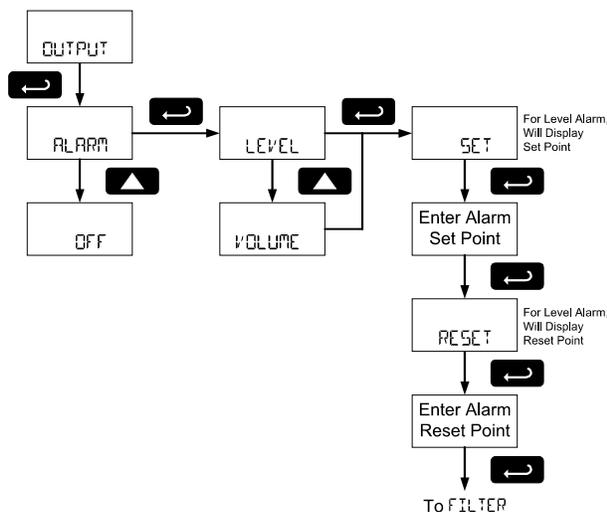

Input Signal Filter (FILTER)

The noise filter is available for unusually noisy signals that cause an unstable process variable display. The noise filter averages the input signal over a certain period. The filter level can be set to low (LO), medium (MED), high (HI), or off (OFF). The higher the filter setting, the longer the averaging time and so the longer the display may take to find its final value.


The filter contains a noise filter bypass feature so that while small variations in the signal will be filtered out, large, abrupt changes to the input signal are displayed immediately.

Volume Display Scaling (VOLSCALE)

Volume may be scaled as a function of the level display. It may use up to 32-point linearization. The multi-point linearization can be used to linearize the display for non-linear signals such as those from level transmitters used to measure volume in odd-shaped tanks.

To scale the volume display, select the decimal point location (0, 1, 2, 3, or 4), then enter the level in engineering units for input 1, the corresponding volume display value, and the same for input 2.


After entering the display 2 value, confirm the new volume scale by pressing **ENTER** at the Save menu.

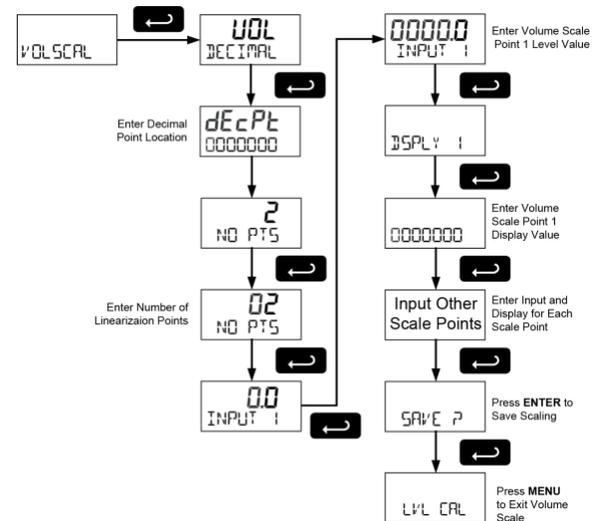

Note:
To display the volume, see *Configuring the Display (DISPLAY)* on page 13.

Level Input Live Signal Calibration (LVL CAL)

The meter can be calibrated using a current source instead of scaling. This process will override previously programmed scaling of the level display. The use of a calibrated signal source is strongly recommended.

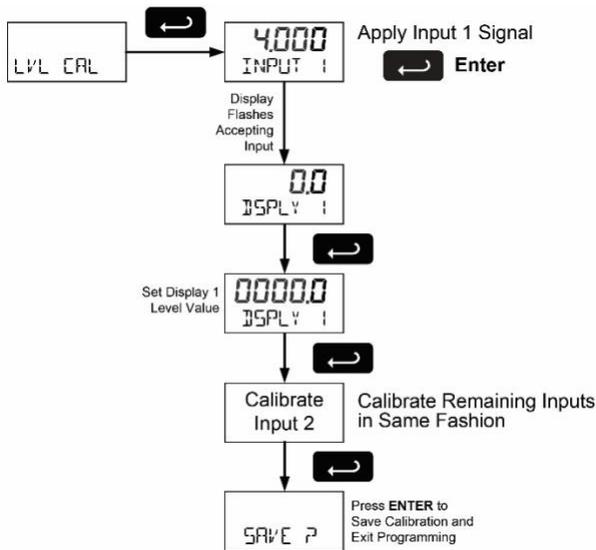

Internal Calibration (ICAL)

There is **no need to recalibrate** the meter when first received from the factory. The meter is **factory calibrated** prior to shipment. The calibration equipment is traceable to NIST standards.

The internal calibration is the meter’s master calibration that makes scaling the meter without a signal source possible. Use of a calibrated signal source is necessary to perform an internal calibration of the meter. Check calibration of the meter at least every 12 months. Incorrect calibration will affect the ability of the meter to properly read, scale, and display the input.

Press **MENU**, navigate to **ADVANCE** and press **ENTER** to access the *Advanced Features Menu*. Press the **UP** arrow button to scroll to the *Internal Calibration* menu (**ICAL**) and press **ENTER**.

The meter displays **4.000**. Apply a 4.000 mA signal and press **ENTER**. The display flashes for a moment while the meter is accepting the signal. After the signal is accepted, the meter displays **20.000**. Apply a 20.000 mA signal and press **ENTER**. The display flashes for a moment while the meter is accepting the signal.

Notes:

1. The signal source must have a full-scale accuracy of 0.002% or better between 4 and 20 mA in order to maintain the specified accuracy of the meter.
2. Allow the meter to warm up for at least 15 minutes before performing the calibration procedure.


Calibration Error Message (SPN ERR)

An error message indicates that the calibration process was not successful. After the error message is displayed, the meter will revert to the **INPUT 1** calibration menu. The error message might be caused by inadvertently leaving the signal at the previous level or not maintaining the minimum span. Press the **MENU** button to cancel the current calibration process if necessary.

Level Input Multipoint Linearization (MULTIPT)

This menu enables multipoint linearization for scaling and calibrating of the level display.

Setting **MULTIPT** to **ENABLE** allows the level display to be scaled or calibrated using up to 32 points. See *Scaling the Meter (SCALE)* on page 13 and *Level Input Live Signal Calibration (LVL CAL)* on page 18, to include a *Number of Points (NO PTS)* parameter before entering *Input 1*. The 32-point linearization is used to linearize the display for non-linear signals.

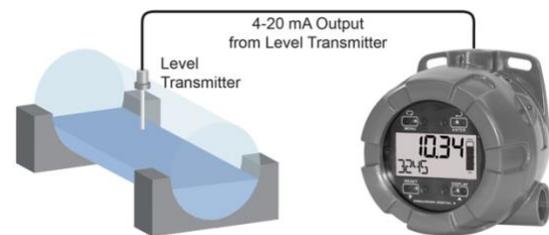

PD6700L Displaying Height in Feet and Volume (Using Multi-Point Linearization Feature) in Gallons in a Round Horizontal Tank.

Information (INFO)

The *Information* menu shows the software identification number and version number. To determine the software version of a meter:

Go to the *Information* menu (**INFO**) and press **ENTER** button.

Continue pressing **ENTER** to scroll through the software release number and software version. Following the information display, the meter will exit the *Advanced Features* menu and return to run mode.

Operation

Front Panel Buttons Operation

Button Symbol	Description
 MENU	Press to Enter or Exit Programming Mode
 RESET	Used to Reset Maximum and Minimum Values
 DISPLAY	Press to Cycle Displaying Maximum Value, Minimum Value, and Input Current in mA Press to Resume Run Mode in Lower Display
 ENTER	Press to Acknowledge Alarm (if Enabled)

Display Maximum, Minimum, and Input Current

The maximum and minimum values and the measured input loop current may be displayed temporarily on the lower display. To display these values, press the **DISPLAY** button. The meter will display the word **MAXIMUM** on the lower display and the maximum value reached (since the last maximum reset) on the top display. Press the **DISPLAY** button again and the meter will display the word **MINIMUM** on the lower display and the minimum value reached on the top display. Pressing the **RESET** button while either of these values is displayed will reset that value to the current display value.

Press the **DISPLAY** button a third time and the meter will display **LOOP MA** on the lower display and the measured input current in milliamps (mA) on the top display. The current display will remain for 10 seconds and then the lower display will return to normal run mode as programmed in *Configuring the Display (DISPLAY)* on page 13. Press the **DISPLAY** button a fourth time to return to the normal operation. The meter will display **RESUME** followed by the run mode lower display.

Reset Meter to Factory Defaults

When the parameters have been changed in a way that is difficult to determine what's happening, it might be better to start the setup process from the factory defaults.



Instructions to load factory defaults:

Enter the *Advanced Features Menu*.

Press and hold **Reset** button when **INFO** is shown. For information on navigating to the *Information menu*, refer to *Advanced Features Menu (ADVANCE)* on page 15.

Press **Enter** when **RESET DEFAULTS?** prompt is shown.

Note: If **Enter** is not pressed within three seconds, the prompt will stop flashing return to showing **INFO**.

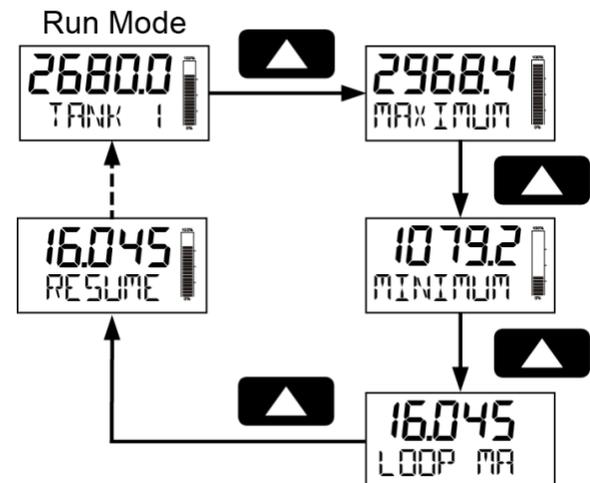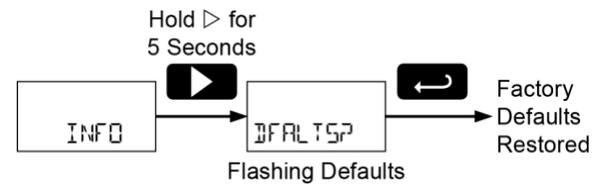

Factory Defaults & User Settings

The following table shows the factory setting for most of the programmable parameters on the meter. Next to the factory setting, the user may record the new setting for the particular application.

Model: _____

S/N: _____

Date: _____

Parameter	Display	Default Setting	User Setting
Basic Setup			
Level Decimal Point	DECIMAL	1111.1	
Input 1	INPUT 1	4.000 mA	
Display 1	DISPLY 1	0.0	
Input 2	INPUT 2	20.00 mA	
Display 2	DISPLY 2	100.0	
Tank Indicator 0%	0 PCT	0.0	
Tank Indicator 100%	100 PCT	100.0	
Lower Display	BOTTOM	Tag	
Bargraph	GRAPH	On	
Tag	TAG	TANK 1	
Advanced Features			
Output	OUTPUT	Off	
Filter	FILTER	Low	
Volume Decimal Point	UDL DECIMAL	0000000	
Volume Scale Number of Points	NO PTS	02	
Volume Scale Input 1	INPUT 1	0.0	
Volume Display 1	DISPLY 1	0	
Volume Scale Input 2	INPUT 2	100.0	
Volume Display 2	DISPLY 2	100,000	
Multipoint	MULTIPT	Disable	
Password			
Password	PASSWORD	00000 (unlocked)	

Troubleshooting

Due to the many features and functions of the meter, it's possible that the setup of the meter does not agree with what an operator expects to see. If the meter is not working as expected, refer to the *Diagnostics* menu and consult the recommendations described in the following table.

Troubleshooting Tips

Symptom	Check/Action
No display or faint display	Check input signal connections. Perform hard reset by shorting S+ and S- terminals.
Level display unsteady	Increase filter setting in <i>Advanced</i> menu.
Meter displays error message during calibration (SPN ERR)	Check signal connections. Verify minimum input span requirements.
Level display flashes 99999 or -9999	Check input signal and scaling within range of 99999 & -9999
Volume display flashes 9999999 or -999999	Check level display within volume scale range of 9999999 & -999999.
Display response is too slow	Check filter setting to see if it can be lowered to <i>LO</i> or <i>OFF</i> .
If the display locks up or the meter does not respond at all	Perform hard reset by shorting S+ and S- terminals.
Backlight does not appear.	Backlight may not be noticeable under good lighting conditions. Check connections are as shown in <i>Figure 5</i> or <i>Figure 6</i> on page 8.
SafeTouch buttons do not respond	Mechanical button was pushed or SafeTouch slide switch is in lock position. The SafeTouch buttons will be re-enabled automatically 60 seconds after the last button push. If slide switch on connector board is in Lock position, switch to Unlock. Sunlight can interfere with the sensors. It is recommended to shield the window from sunlight while operating the buttons by standing so as to block direct sunlight.
Other symptoms not described above	Call Technical Support for assistance.


Quick User Interface Reference

Pushbutton	Function
MENU	Go to programming mode or leave programming. Hold for 5 seconds to enter <i>Advanced Features</i> menu directly.
RIGHT Arrow	Move to next digit. Go to previous menu or alphanumeric character selection. Reset max or min while displayed.
UP Arrow	Move to next selection or increment digit. Cycle through maximum, minimum, and mA display mode.
ENTER	Accept selection/value and move to next selection. Acknowledge alarms.


To enter the Advanced Features Menu, hold the **Menu** button for 5 seconds.

Max/Min Mode


While in Run Mode, pressing **Up Arrow** will initiate MAX/MIN Mode. **Up Arrow** toggles between MAX & MIN displays, and **Right Arrow** resets the MAX/MIN to the current value. Press **Menu** or wait 10 seconds to return to Run Mode. Pressing **Enter/Ack** will disable the 10 second timeout and continuously display Max or Min.

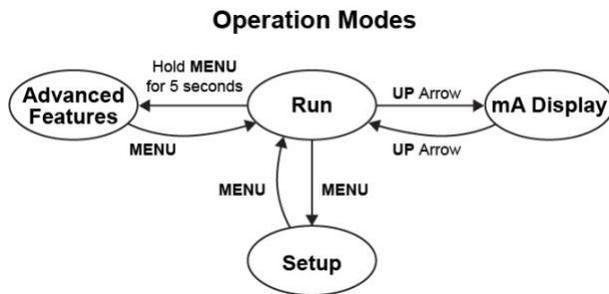

Main Menu

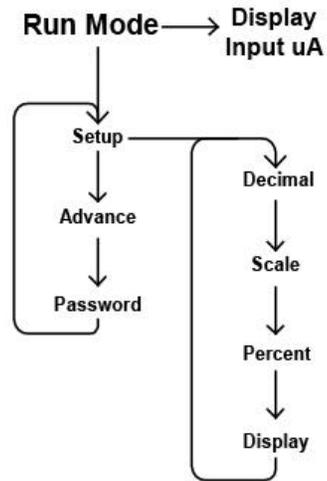

Advanced Menu

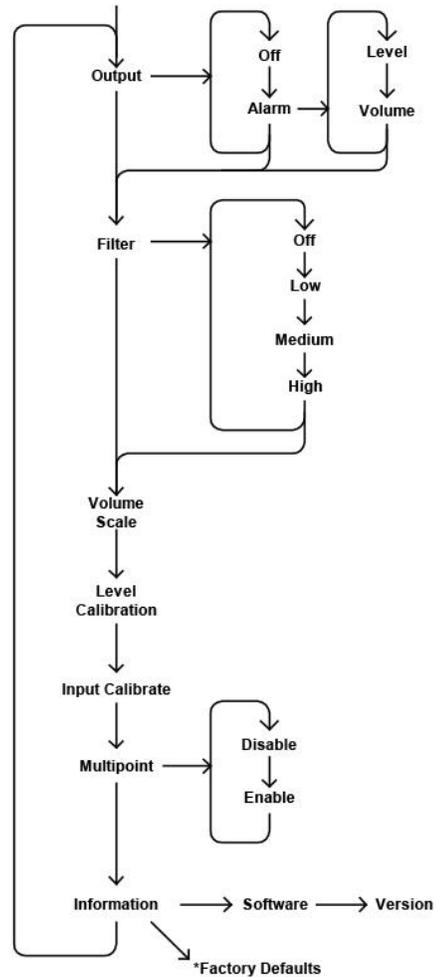

*Access by holding **Right/Reset** for 3 seconds

Contact Precision Digital

Technical Support

Call: (800) 610-5239 or (508) 655-7300

Fax: (508) 655-8990

Email: support@predig.com

Sales Support

Call: (800) 343-1001 or (508) 655-7300

Fax: (508) 655-8990

Email: sales@predig.com

Place Orders

Email: orders@predig.com

For the latest version of this manual please visit

www.predig.com

PRECISION DIGITAL CORPORATION

233 South Street • Hopkinton MA 01748 USA

Tel (800) 343-1001 • Fax (508) 655-8990

www.predig.com

